

Service Bulletin

Bulletin No HUK000000000763



Transmission

Model	Model Code	Year Mode
IVIC 5D	FK1, FK2, FK3	06

Issue Date 10-03-06

Originator
Product Technical/QIC
Product Technical/QIC

<u>Difficult Engagement of Gears - Manual Transmission.</u> <u>Civic 06MY</u>

Symptom

Poor gearshift feeling when selecting gears or selection is impossible.

Cause

Gear change cables damaged during fitment of cable retaining clip to transmission casing.

Countermeasure

Gear change cable attachment procedure countermeasured to prevent damage to the cables.

Application to Production Line

SHHFK1***6U003555 SHHFK2***6U008251 SHHFK3***6U008261

Repair Method

- Confirm symptom of difficult or impossible selection of gears.
- Inspect gear change cables paying attention to transmission end for any damage. See example photo:



 If required replace affected gear change cables with a new part.

FK1



FK2



FK3



 If no gear change cable damage is found then continue with normal diagnosis procedures.

CONTINUATION SHEET

Bulletin No HUK000000000763

Parts Information

Order required gear change cable as per EPC.

Warranty Information

Application: Normal warranty applies

Causal Part: 54310

NEWS Symptom Code: 03101

Operation No.(LON-NEWS Only): 212150

FRT: 2.1Hrs