


HONDA <i>Informazione di Servizio</i>			Informazione N° SG-06-001-00	
			Sospensioni	
Modello	Codice Modello	Anno Modello	Data di pubblicazione	
CIVIC 5D	FK1, FK2, FK3	06	21-03-06	
			Compilatore HOHL HASSA (Switzerland)	

Coming from noise from the posterior suspensions. Civic 2006 (CIVIC 5D)

Symptom

The customer has found strikes or coming from vibrations from the posterior part of the car during the guide on dissestate roads.

Cause

The movement of the ring of the inner piston of the shock-absorber provokes noises during the normal operation.

Countermeasure

The design and the material of the ring of the piston of the shock-absorber have been modified.

Modification in production

SHHFK1 *** 6U003335

SHHFK2 *** 6U008008

SHHFK3 ***
6U007933



Method of repair

To carry out the test on road and to verify the symptoms.

Beyond carrying out the test on road, to control if there are others it inside upgrades them sources of noisiness of the car, especially the devices you of implantation and the replies of the posterior seats.


To raise the car with a tackle and to carry out the visual control in order to verify if there are others upgrade them noisiness sources (devices you of implantation of the suspensions/drainage system, etc)

To control the categorical number on the label applied to the shocks-absorber and to confront it with the attached table.

If the shocks-absorber are **previous to the modernized member**, to replace them.

		Categorical number modernized member	
Car	Categorical number member previous to the modernized member	Temporary component code	Definitive component code
Benzine, wheels from 16 '	5610 SMG E031-M1	52610 SMG E031-C1	52610 SMG E040-M1
Benzine, wheels from 17 '	52610 SMG G021-M1	52610 SMG G021-C1	52610 SMG G030-M1
Diesel	52610 SMJ E021-M1	52610 SMJ E021-C1	52610 SMJ E030-M1

PAG.1 OF 2
It continues

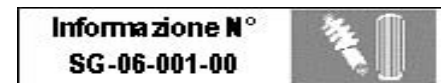

Necessary particular

<i>Code reciprocation</i>	<i>Name reciprocation</i>
52610-SMG-E04	Benzine, wheels from 16 "
52610-SMG-G03	Benzine, wheels from 17 "
52610-SMJ-E03	Diesel

Conditions of guarantee

Application : Normal Code leaves main: 52610 Code symptom: 04208

LON	Description	FRT
417101	Substitution of both the posterior shocks-absorber 0,8 hours	