



Model	Model Code	Year Model	Issue Date
CIVIC 5D	FK2, FK3	06	25-09-06
			Originator Product Technical/DIC Product Technical/DIC

HFT Outgoing voice clarity distorted / poor quality
This updates HUK00000000822 with new warranty information

Symptom

The driver complains that the person on the other end of the phone line is complaining that they cannot hear the driver due to distortion in the drivers voice or excessive background noise.

Cause

The gap between the microphone and the grille section of the interior light surround allows road noise to be amplified around the microphone housing.

Application to Production Line

SHHPK2***6U*****
SHHPK3***6U*****



Application to production line to be confirmed.

Repair Method

Repair to be carried out on customer complaint only


Apply EPT sealer to the top of the microphone to close the gap between the interior light cover and the microphone casing.

1. Remove the interior light cover.

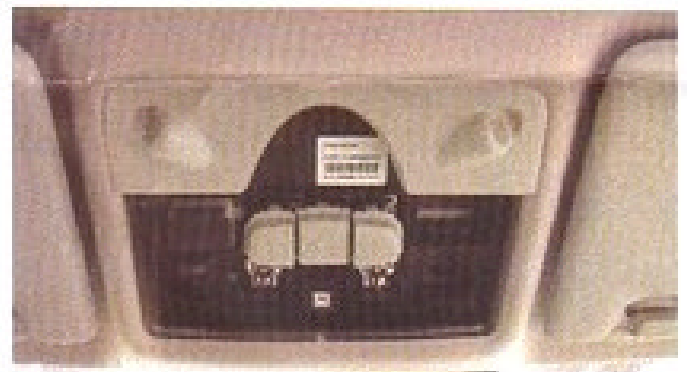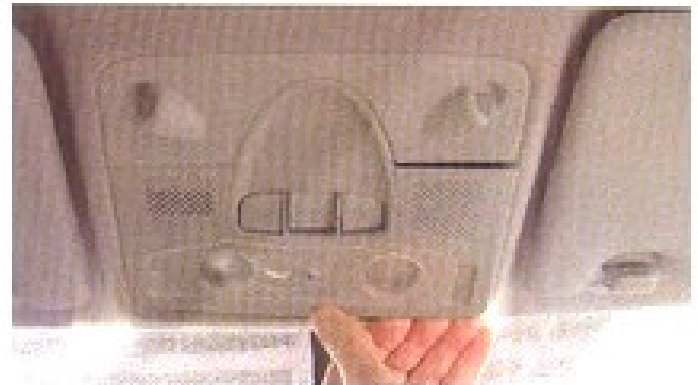


2. Using a Sharp pair of scissors cut a pelce of the EPT sealer foam to the following measurements.

Length = 28mm
Width = 18.5mm

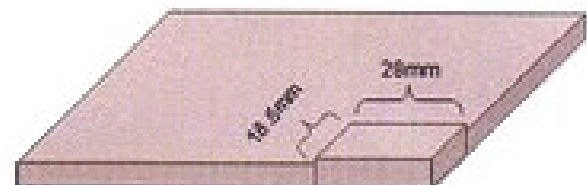


3. Once you have cut the square section of EPT sealer from the main roll of material place the square section on a flat surface and cut out the following sections shown below using a sharp knife or scalpel.

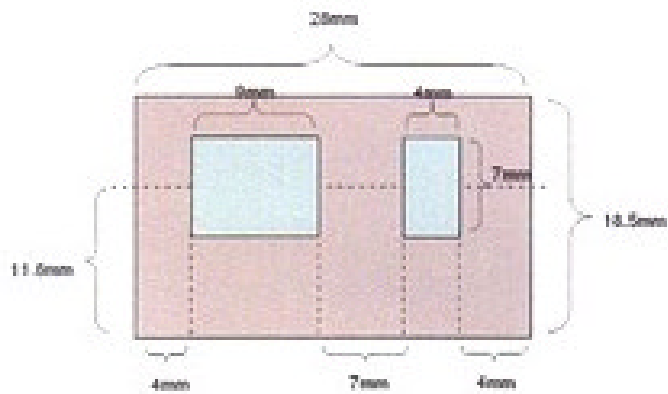

4. When you have cut out the sections from the EPT sealer place the sealer onto the top off the microphone as shown below.

Note : Do not remove the black cover on top of the microphone.

Note : Ensure the foam is applied with the correct orientation so that the smaller cut out section is placed next to the interior light switch

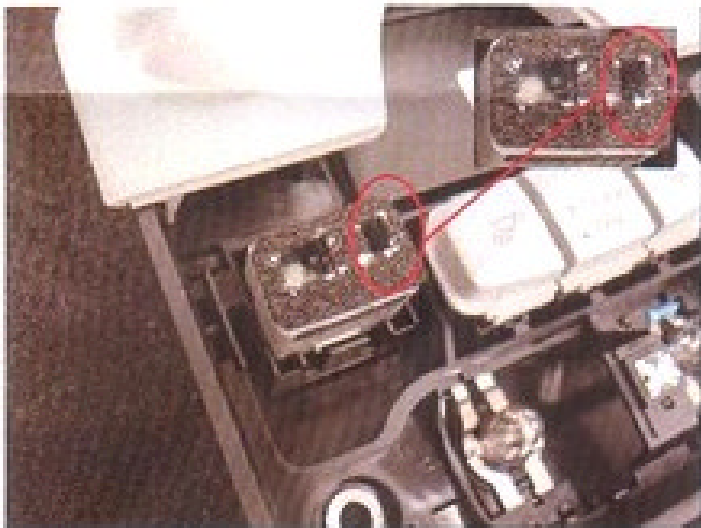

5. Replace all parts in reverse of removal.

6. Confirm operation of HFT system when stationary and when driving.

Parts Information

EPT Sealer (3mm)
06990-SA5-000

NOTE: One strip of foam is sufficient to repair a number of vehicles.

Warranty Information

Application : Normal warranty applies

Causal part : 39182-SMG-E01

NEWS code : 04210

LON : 7151B6

FRT : 0.3

Enter £1.00 in Sublet/Extra Costs field for EPT sealer used per claim.